
LOGSTOR BX Installation Instructions - Industry



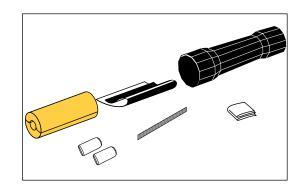

Application

BXJoints are used to join pipes with outer casing dimensions ø 90-630 mm.



Tools

It is recommended to use the following tools when installing BXJoints:


Туре:	Application:


- 1. Saw Adjusting insulation shells
- 2. Emery cloth Surface activation
- 3. Gas burner, Surface activation, ø 50 mm Shrinking film and sleeve.
- 4. Hammer Installng pipe coupling
- 5. Spoon bit Pre-drilling around ø 29 mm perforated plastic tubes
- 6. Plastic tube cutter Shortening the tracer pipe

Preinstallation of casing joint

1. Place the shrink sleeve with packing on one of the pipes, before the service pipes are joined.


Notice! Align the pipes with the tracer pipe in 6 o'clock position to facilitate later installation of the tracer pipe.

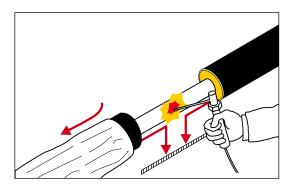

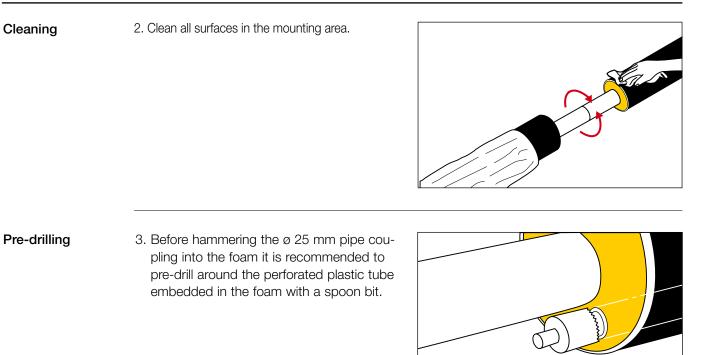


Installing the pipe coupling

4. Place the pipe coupling against the tube in the foam.

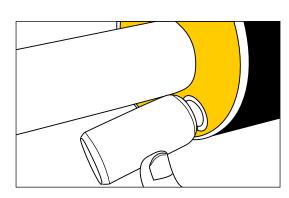

 Hammer the coupling approx. 25-30 mm into the foam.
It is recommended to use a plastic-covered, recoilless hammer.

Repeat items 3-5 at the opposite pipe end.

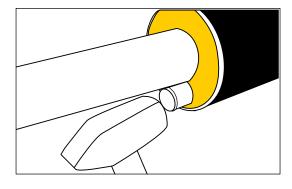


Installing the tracer pipe


6. Measure the distance x and adjust the length of the tracer pipe to x -20 mm.


7. Pull the drag line through the tracer pipe.

8. Insert the tracer pipe into the pipe couplings at each pipe end and secure it to the service pipe with tape.


Adjusting insulation shells 9. Shorten the insulation shells to make them fit tightly between the casing pipes.

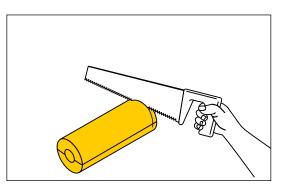

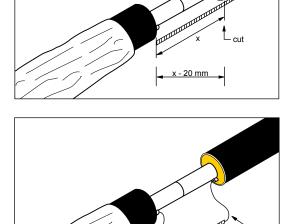

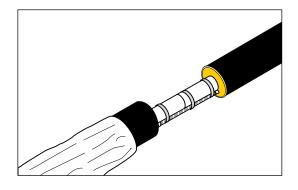


Drag line

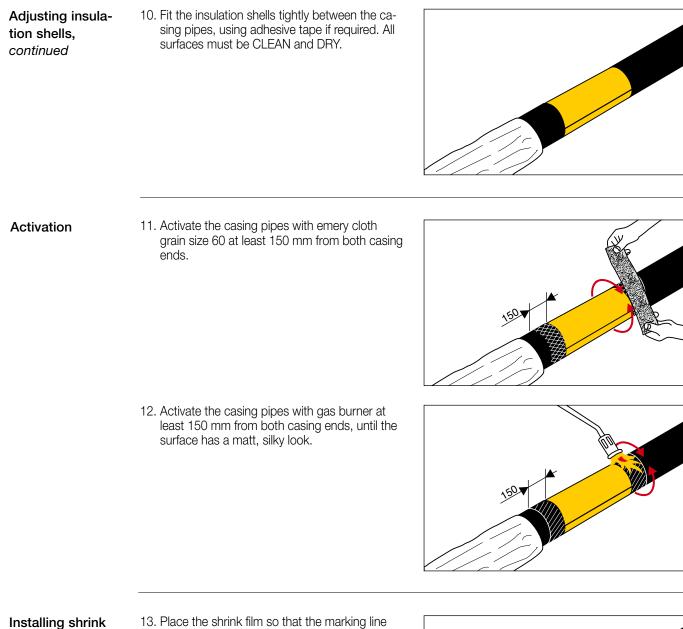


Installing shrink film

- 3. Place the shrink film so that the marking line forms a ring around the pipe. Attach one edge of the shrink film in the "10 o'clock" position.
- 14. Pull the film around the pipe by removing the adhesive paper so that the film adheres to the surface beneath it.

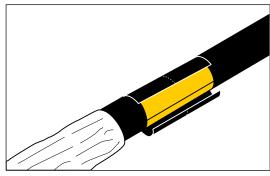

Installing shrink film, *continued*

15. Heat the whole film from the centre towards the sides, ensuring that the mastic becomes visible at all edges and that the shrink film is tightly fitted.

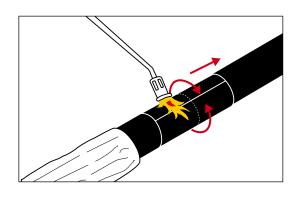



Positioning shrink sleeve


- 16. Remove the packing from the shrink sleeve. Check that the sleeve is CLEAN and DRY, inside and out. Remove the protective foil from the mastic.
- 17. Centre the shrink sleeve on the joint and mark it. Remove the mastic covering and make sure that all the foil has been removed.

Shrinkage

 First, shrink from the middle towards one end, then from the middle towards the other end. Avoid heating directly on the casing.

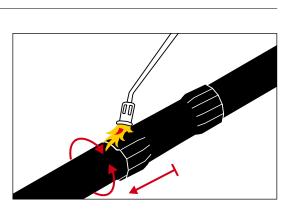


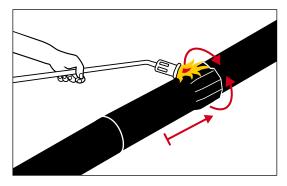

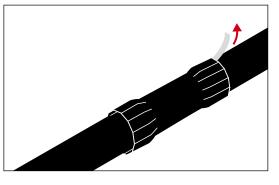


Shrinkage, continued

- 19. Shrink until all expansion marks have vanished and the end of the sleeve forms an almost straight encircling edge.
- A. Before B. After

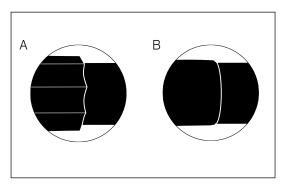

Completed joint

20. The joint is complete.

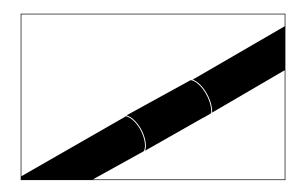

Contact details

Denmark

LOGSTOR Denmark Holding ApS Danmarksvej 11 | DK-9670 Løgstør

T: +45 99 66 10 00

E: logstor@kingspan.com



For the product offering in other markets please contact your local sales representative or visit www.logstor.com

Care has been taken to ensure that the contents of this publication are accurate, but Kingspan Limited and its subsidiary companies do not accept responsibility for errors or for information that is found to be misleading. Suggestions for, or description of, the end use or application of products or methods of working are for information only and Kingspan Limited and its subsidiaries accept no liability in respect thereof.

To ensure you are viewing the most recent and accurate product information, please scan the QR code directly above.

